SAFETY DATA SHEET

SECTION 1- MANUFACTURER'S IDENTIFICATION

Product Name: AC 301 EXTERIOR WOOD PRIMER Product Code: H-1404

Manufacturer's Name: Induron Protective Coatings, LLC
Address: 3333 Richard Arrington Blvd. N.
Birmingham, Alabama 35234

Emergency Phone: 1-800-424-9300
Information Phone: (205)324-9584

Section 2 - Composition / Information on Ingredients

GHS Ratings:

Flammable liquid	3	Flash point >= 23°C and <= 60°C (140°F)
Skin corrosive	2	Reversible adverse effects in dermal tissue, Draize score: >= 2.3 < 4.0 or persistent inflammation
Respiratory sensitizer	1	Respiratory sensitizer
Mutagen	1B	Known to produce heritable mutations in human germ cellsSubcategory 1B, Positive results: In vivo heritable germ cell tests in mammals, Human germ cell tests, In vivo somatic mutagenicity tests, combined with some evidence of germ cell mutagenicity
Carcinogen	1B	Presumed Human Carcinogen, Based on demonstrated animal carcinogenicity
Reproductive toxin	1A	Based on human evidence
Aspiration hazard	1	Aspiration Toxicity Category 1: Known (regarded)- human evidence - hydrocarbons with kinematic viscosity ? 20.5 mm2/s at 40° C.

GHS Hazards

H226	Flammable liquid and vapour.
H304	May be fatal if swallowed and enters airways
H315	Causes skin irritation
H334	May cause allergy or asthma symptoms or breathing difficulties if inhaled
H340	May cause genetic defects
H350	May cause cancer
H360	May damage fertility or the unborn child

GHS Precautions

P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P261	Avoid breathing dust/fume/gas/mist/vapours/spray.
P264	Wash equipment and contaminated skin thoroughly after handling.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P281	Use personal protective equipment as required
P285	In case of inadequate ventilation wear respiratory protection
P321	Wash contaminated skin, follow Physcian's instructions for treatment.
P331	Do NOT induce vomiting
P362	Take off contaminated clothing and wash before reuse

P301+P310	IF SWALLOWED: Immediately call a POISON CENTER or doctor/physician
P302+P352	IF ON SKIN: Wash with soap and water
P303+P361+P353	IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower
P304+P341	IF INHALED: If breathing is difficult, remove victim to fresh air and keep at rest in a position comfortable for breathing
P308+P313	IF exposed or concerned: Get medical advice/attention
P332+P313	If skin irritation occurs: Get medical advice/attention
P342+P311	If experiencing respiratory symptoms: Call a POISON CENTER/doctor/physcian.
P370+P378	In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.
P405	Store locked up
P403+P235	Store in a well ventilated place. Keep cool
P501	Dispose of contents/container in accordance to approriate regulations and laws.

Signal Word: Danger

Preexisting skin, eye, and respiratory disorders may be aggravated by exposure to this product. Impaired kidney and liver functions from preexisting disorders may be aggravated by exposure to this product.

Kidney damage may be evidenced by changes in urine output, urine appearance, or edema (swelling from fluid retention). Liver damage may be evidenced by loss of appetite, jaundice and sometimes pain in the upper abdomen on the right side.

Section 3 - Hazards Identification

Chemical Name	CAS number	Weight Concentration %
STODDARD SOLVENT	8052-41-3	30.53%
Titanium Dioxide Colorant	13463-67-7	14.49%
*! BARIUM METABORATE MONOHYDRATE	13701-59-2	4.57%
Mica	12001-26-2	3.44%
Mixed Xylenes	1330-20-7	1.99%
2-ETHYL BENZENE	91-20-3	0.97%
2-ETHYL BENZENE	100-41-4	0.62%
Naphtha, petroleum, hydrotreated heavy	64742-48-9	0.31%
METHYL ETHYL KETONE OXIME	96-29-7	0.20%

Section 4 - First Aid Measures

INHALATION - If product solids are inhaled either as dust or in the form of a spray mist, remove the person from exposure immediately. If breathing is difficult, irregular, or has stopped, start resuscitation; call a physician . Administer oxygen if a qualified operator is available.

EYE CONTACT - In case of eye contact, flush the eyes with water for fifteen (15) minutes. If contact lenses are worn, quickly remove them, then flush the eyes with water. Have a physician examine the eyes.

SKIN CONTACT - In case of skin contact, remove contaminated clothing. Flush the skin with large amounts of water, then wash the skin with soap and water.

INGESTION - If material is ingested, seek immediate medical attention. If vomiting occurs spontaneously, keep the

head below the hips to prevent aspiration of liquid into the lungs.
Notes to Physician: No data found

Section 5 - Fire Fighting Measures

Flash Point: 27 C (81 F)

LEL: 1.00 UEL:

Non Combustible Product

EXTINGUISHING MEDIA: Use carbon dioxide (CO2), "alcohol" foam, dry chemical systems, water spray, normal water extinquishing.
UNUSUAL FIRE OR EXPLOSION HAZARDS: The product may contain vapors that will flash, but will not catch on fire.
HAZARDOUS COMBUSTION PRODUCTS: Oxides of carbon and hydrocarbons

FIRE FIGHTING: If evacuation of personnel is necessary, evacuate to an upwind area . Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.Use water spray to cool unopened containors.
Fire Equipment: If evacuation of personnel is necessary, evacuate to an upwind area . Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

Section 6 - Accidental Release Measures

SPILL AND LEAK PROCEDURES: Spill supervisor - Ensure cleanup personnel wear all appropriate Personal Protective Equipment (PPE), including respiratory protection. Remove all ignition sources. Keep nonessential personnel away from the contaminated area.
SMALL SPILLS: Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant materials with water to prevent spontaneous combustion with alkyd type formulas.

Dispose of the waste in compliance with all Federal, state, regional, and local regulations.
LARGE SPILLS: Prevent this material from entering sewers and watercourses by diking or impounding the spilled material. Advise authorities if the product has entered or may enter, sewers, watercourses, or extensive land areas .

Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant with water for alkyd type spills.

Section 7 - Handling and Storage

HANDLING PRECAUTIONS: Wear all appropriate Personal Protective Equipment (PPE). Wear respiratory protection or ensure adequate ventilation at all times as vapors can accumulate in confined or poorly ventilated areas. Use the product in a manner which minimizes splashes and/or the creation of dust. Keep containers closed when not in use. Do not handle or store material near heat, sparks, open flames, or other sources of ignition. Store at room temperatures, i.e., 40 to 95 F (4 to 35 C).
STORAGE: Prevent from freezing. Do not store above 120 F (49 C).

Store only in original containers.

REGULATORY REQUIREMENTS: No data found.

Section 8 - Exposure Controls / Personal Protection

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits

STODDARD SOLVENT 8052-41-3	500 ppm TWA; 2900 mg/m3 TWA	100 ppm TWA	NIOSH: 350 mg/m3 TWA 1800 mg/m3 Ceiling (15 min)
Titanium Dioxide Colorant 13463-67-7	15 mg/m3 TWA (total dust)	10 mg/m3 TWA	Not Established
*! BARIUM METABORATE MONOHYDRATE 13701-59-2	Not Established	Not Established	Not Established
Mica 12001-26-2	Not Established	3 mg/m3 TWA (respirable fraction)	NIOSH: 3 mg/m3 TWA (containing <1% Quartz, respirable dust)
Mixed Xylenes 1330-20-7	100 ppm TWA; 435 mg/m3 TWA	150 ppm STEL 100 ppm TWA	Not Established
2-ETHYL BENZENE 91-20-3	10 ppm TWA; 50 mg/m3 TWA	10 ppm TWA	NIOSH: 10 ppm TWA; 50 mg/m3 TWA 15 ppm STEL; 75 mg/m3 STEL
2-ETHYL BENZENE 100-41-4	100 ppm TWA; 435 mg/m3 TWA	20 ppm TWA	NIOSH: 100 ppm TWA; 435 mg/m3 TWA 125 ppm STEL; 545 mg/m3 STEL
Naphtha, petroleum, hydrotreated heavy 64742-48-9	Not Established	Not Established	Not Established
METHYL ETHYL KETONE OXIME 96-29-7	Not Established	Not Established	Not Established

ENGINEERING: Ensure processing (curing) ovens are properly vented to prevent the introduction of processing fumes into the workplace. Use explosion-proof equipment and good manufacturing practice.

VENTILATION: Use only with adequate ventilation, i.e., ventilation in compliance with occupational exposure limits.

ADMINISTRATIVE CONTROLS: No data found.

PROTECTIVE EQUIPMENT: Wear splash goggles. If extra protection is required, wear a face shield over the splash goggles. Face shields are effective only if worn in addition to splash goggles.

Wear a chemical-resistant, butyl-rubber apron and other protective clothing, as deemed appropriate, to avoid skin contact with material.

Wear chemical-resistant gloves (butyl rubber or neoprene). Protective gloves should be inspected frequently and discarded when they exhibit cuts, tears, pinholes, or signs of excessive wear.

CONTAMINATED EQUIPMENT: Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

Section 9 - Physical and Chemical Properties

This mixture typically exhibits the following properties under normal circumstances:

Viscosity: N/A	**Coating VOC Lb/Gal** 3.82
Appearance: N/A	**Odor:** N/A
Vapor Pressure: 28.9 mmHg	**Odor threshold:** N/A
Vapor Density: 3.8	**pH:** N/A
DENSITY 10.21	**Melting point:** N/A
Freezing point: N/A	**Solubility:** N/A

Boiling range: 138°C	**Flash point:** 81 F,27 C
Evaporation rate: N/A	**Flammability:** N/A
Explosive Limits: N/A	**Partition coefficient (n-octanol/water):** N/A
Autoignition temperature: N/A	**Decomposition temperature:** N/A

Section 10 - Stability and Reactivity

Stability: This product is stable under normal storage and handling.

STABLE

Components of this mixture are incompatible with the following materials: Strong acids and bases can cause coagulation of the latex and failure of the product

This mixture is likely to exhibit the following combustion products: aliphatics and carbon oxides.

Hazardous polymerization will not occur.

Section 11 - Toxicological Information

Mixture Toxicity

Inhalation Toxicity LC50: 54mg/L

Routes of Entry:

Exposure to this material may affect the following organs:

Blood **Eyes** **Kidneys** **Liver** **Central Nervous System** **Skin** **Respiratory System**

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

CAS Number	Description	% Weight	Carcinogen Rating
64742-48-9	Naphtha, petroleum, hydrotreated heavy	0.307	Naphtha, petroleum, hydrotreated heavy: EU REACH: Present (P)
13463-67-7	Titanium Dioxide Colorant	14.49	Titanium Dioxide Colorant: NIOSH: potential occupational carcinogen IARC: Possible human carcinogen OSHA: listed
100-41-4	2-ETHYL BENZENE	0.622	2-ETHYL BENZENE: IARC: Possible human carcinogen OSHA: listed
8052-41-3	STODDARD SOLVENT	30.53	STODDARD SOLVENT: EU REACH: Present (P)
91-20-3	2-ETHYL BENZENE	0.965	2-ETHYL BENZENE: IARC: Possible human carcinogen OSHA: listed

Section 12 - Ecological Information

Ecological information: .

Component Ecotoxicity

Mixed Xylenes	96 Hr LC50 Pimephales promelas: 13.4 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 2.661 - 4.093 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 13.5 - 17.3 mg/L; 96 Hr LC50 Lepomis macrochirus: 13.1 - 16.5 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 19 mg/L; 96 Hr LC50 Lepomis macrochirus: 7.711 - 9.591 mg/L [static]; 96 Hr LC50 Pimephales promelas: 23.53 - 29.97 mg/L [static]; 96 Hr LC50 Cyprinus carpio: 780 mg/L [semi-static]; 96 Hr LC50 Cyprinus carpio: >780 mg/L; 96 Hr LC50 Poecilia reticulata: 30.26 - 40.75 mg/L [static] 48 Hr EC50 water flea: 3.82 mg/L; 48 Hr LC50 Gammarus lacustris: 0.6 mg/L
2-ETHYL BENZENE	96 Hr LC50 Pimephales promelas: 5.74 - 6.44 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 1.6 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 0.91 - 2.82 mg/L [static]; 96 Hr LC50 Pimephales promelas: 1.99 mg/L [static]; 96 Hr LC50 Lepomis macrochirus: 31.0265 mg/L [static] 48 Hr LC50 Daphnia magna: 2.16 mg/L; 48 Hr EC50 Daphnia magna: 1.96 mg/L [Flow through]; 48 Hr EC50 Daphnia magna: 1.09 - 3.4 mg/L [Static]
2-ETHYL BENZENE	96 Hr LC50 Oncorhynchus mykiss: 11.0 - 18.0 mg/L [static]; 96 Hr LC50 Oncorhynchus mykiss: 4.2 mg/L [semi-static]; 96 Hr LC50 Pimephales promelas: 7.55 - 11 mg/L [flow-through]; 96 Hr LC50 Lepomis macrochirus: 32 mg/L [static]; 96 Hr LC50 Pimephales promelas: 9.1 - 15.6 mg/L [static]; 96 Hr LC50 Poecilia reticulata: 9.6 mg/L [static] 48 Hr EC50 Daphnia magna: 1.8 - 2.4 mg/L 72 Hr EC50 Pseudokirchneriella subcapitata: 4.6 mg/L; 96 Hr EC50 Pseudokirchneriella subcapitata: >438 mg/L; 72 Hr EC50 Pseudokirchneriella subcapitata: 2.6 - 11.3 mg/L [static]; 96 Hr EC50 Pseudokirchneriella subcapitata: 1.7 - 7.6 mg/L [static]
Naphtha, petroleum, hydrotreated heavy	96 Hr LC50 Pimephales promelas: 2200 mg/L
METHYL ETHYL KETONE OXIME	96 Hr LC50 Pimephales promelas: 777 - 914 mg/L [flow-through]; 96 Hr LC50 Poecilia reticulata: 760 mg/L [static] 48 Hr EC50 Daphnia magna: 750 mg/L 72 Hr EC50 Desmodesmus subspicatus: 83 mg/L

Section 13 - Disposal Considerations

As the US EPA, state, regional, and other regulatory agencies may have jurisdiction over the disposal of your facility's hazardous waste, it is incumbent upon you, the hazardous waste generator, to learn of and satisfy all the requirements which affect you. Dispose of the hazardous waste at a properly licensed and permitted disposal site or facility. Ensure conformity to all applicable hazardous waste disposal regulations.

The US EPA Hazardous Waste Numbers which follow are applicable to this unadulterated product if the product enters the "waste stream." Refer to Title 40 of the Code of Federal Regulations, Part 261 (40 CFR 261). This part of the Code identifies solid wastes which are subject to regulation under various sections of the Code and which are subject to the notification requirements of Section 3010 of the Resource Conservation and Recovery Act (RCRA).

Section 14 - Transport Information

Section 14 - Transport Information

Not regulated by CFR 49.172.1

Agency	Proper Shipping Name	UN Number	Packing Group	Hazard Class
DOT	PAINT	1263	III	3
IATA	PAINT	1263	III	3

15: Regulatory Information

State of California Safe Drinking Water and Toxic Enforcement Act of 1986 (Proposition 65): WARNING! This product contains the following chemicals which are listed by the State of California as carcinogenic or a reproductive toxin:

100-41-4 2-ETHYL BENZENE 0.62 %
91-20-3 2-ETHYL BENZENE 0.96 %
13463-67-7 Titanium Dioxide Colorant 14.49 %

HAZARDOUS AIR POLLUTANTS

100-41-4 2-ETHYL BENZENE
91-20-3 2-ETHYL BENZENE
1330-20-7 Mixed Xylenes

MASSACHUSETTS RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 0.62 %
91-20-3 2-ETHYL BENZENE 0.96 %
1330-20-7 Mixed Xylenes 1.99 %
12001-26-2 Mica 3.44 %
13463-67-7 Titanium Dioxide Colorant 14.49 %
8052-41-3 STODDARD SOLVENT 30.53 %

NEW JERSEY RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 0.62 %
91-20-3 2-ETHYL BENZENE 0.96 %
1330-20-7 Mixed Xylenes 1.99 %
12001-26-2 Mica 3.44 %
13463-67-7 Titanium Dioxide Colorant 14.49 %
8052-41-3 STODDARD SOLVENT 30.53 %

PENNSYLVANIA RIGHT TO KNOW

100-41-4 2-ETHYL BENZENE 0.62 %
91-20-3 2-ETHYL BENZENE 0.96 %
1330-20-7 Mixed Xylenes 1.99 %
12001-26-2 Mica 3.44 %
13463-67-7 Titanium Dioxide Colorant 14.49 %
8052-41-3 STODDARD SOLVENT 30.53 %

CHEMICAL LIST FOR SARA 311

1330-20-7 Mixed Xylenes

CHEMICAL LIST FOR SARA 311/312

1330-20-7 Mixed Xylenes

CHEMICAL LIST FOR SARA 313

100-41-4 2-ETHYL BENZENE
1330-20-7 Mixed Xylenes

Country	Regulation	All Components Listed

EU Risk Phrases

Safety Phrase

- None

16: OTHER INFORMATION

Hazardous Material Information System (HMIS)

HEALTH	*	1
FLAMMABILITY		3
PHYSICAL HAZARD		1
PERSONAL PROTECTION		G

HMIS & NFPA Hazard Rating Legend
*** = Chronic Health Hazard**
0 = INSIGNIFICANT
1 = SLIGHT
2 = MODERATE
3 = HIGH

National Fire Protection Association (NFPA)

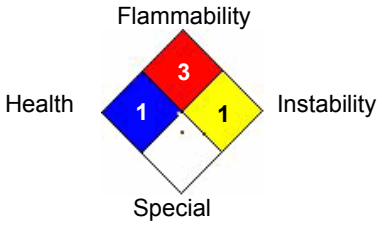

Reviewer Revision

Date Prepared: 11/2/2016