SAFETY DATA SHEET

SECTION 1- MANUFACTURER'S IDENTIFICATION

Product Name: VINYL WASH PRIMER Product Code: H4-1109

Manufacturer's Name: Induron Protective Coatings, LLC

Address: 3333 Richard Arrington Blvd. N. Birmingham, Alabama 35234

Emergency Phone: 1-800-424-9300 Information Phone: (205)324-9584

Section 2 - Composition / Information on Ingredients

GHS Ratings:

Flammable liquid	2	Flash point < 23°C and initial boiling point > 35°C (95°F)
Skin corrosive	1C	Destruction of dermal tissue: Exposure < 4 hours
		Observation < 14 days, visible necrosis in at least one animal
Eye corrosive	1	Serious eye damage: Irreversible damage 21 days after
		exposure, Draize score: Corneal opacity >= 3, Iritis > 1.5
Respiratory sensitizer	1	Respiratory sensitizer
Skin sensitizer	1	Skin sensitizer
Carcinogen	1A	Known Human Carcinogen Based on human evidence
Reproductive toxin	2	Human or animal evidence possibly with other information

GHS Hazards

H225	Highly flammable
H314	Causes severe skin burns and eye damage
H317	May cause an allergic skin reaction
H318	Causes serious eye damage
H334	May cause allergy or asthma symptoms or breathing difficulties if inhaled
H350	May cause cancer
H361	Suspected of damaging fertility or the unborn child

GHS Precautions

recautions	
P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion-proof electrical equipment.
P242	Use only non-sparking tools.
P243	Take precautionary measures against static discharge.
P260	Do not breathe dust/fume/gas/mist/vapours/spray.
P261	Avoid breathing dust/fume/gas/mist/vapours/spray.
P264	Wash equipment and contaminated skin thoroughly after handling.
P272	Contaminated work clothing should not be allowed out of the workplace.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P281	Use personal protective equipment as required
P285	In case of inadequate ventilation wear respiratory protection
P310	Immediately call a POISON CENTER or doctor/physician
P321	Wash contaminated skin, follow Physcian's instructions for treatment.
P363	Wash contaminated clothing before reuse
P301+P330+P331	IF SWALLOWED: Rinse mouth. Do NOT induce vomiting

P301+P330+P331

P302+P352 IF ON SKIN: Wash with soap and water

P303+P361+P353 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing.

Rinse skin with water/shower

SDS for: H4-1109 Page 1 of 7 P304+P340 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable

for breathing

P304+P341 IF INHALED: If breathing is difficult, remove victim to fresh air and keep at rest in

a position comfortable for breathing

P305+P351+P338 IF IN EYES: Rinse continuously with water for several minutes. Remove contact

lenses if present and easy to do – continue rinsing

P308+P313 IF exposed or concerned: Get medical advice/attention
P333+P313 If skin irritation or a rash occurs: Get medical advice/attention

P342+P311 If experiencing respiratory symptoms: Call a POISON CENTER/doctor/physcian.

P370+P378 In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.

P405 Store locked up

P403+P235 Store in a well ventilated place. Keep cool

P501 Dispose of contents/container in accordance to approriate regulations and laws.

Signal Word: Danger







Preexisting skin, eye, and respiratory disorders may be aggravated by exposure to this product. Impaired kidney and liver functions from preexisting disorders may be aggravated by exposure to this product.

Kidney damage may be evidenced by changes in urine output, urine appearance, or edema (swelling from fluid retention). Liver damage may be evidenced by loss of appetite, jaundice and sometimes pain in the upper abdomen on the right side.

Section 3 - Hazards Identification			
Chemical Name CAS number Weight Concentration			
ISOPROPANOL	67-63-0	50.00% - 60.00%	
ISOBUTANOL	78-83-1	20.00% - 30.00%	
Zinc chromate	13530-65-9	5.00% - 10.00%	
Zinc hydroxide	20427-58-1	1.00% - 5.00%	
Talc (hydrous magnesium silicate)	14807-96-6	1.00% - 5.00%	

(1) Serious eye damage: Irreversible damage 21 days after exposure, Draize score: Corneal opacity >= 3, Iritis > 1.5

Section 4 - First Aid Measures

INHALATION - If product solids are inhaled either as dust or in the form of a spray mist, remove the person from exposure immediately. If breathing is difficult, irregular, or has stopped, start resuscitation; call a physician . Administer oxygen if a qualified operator is available.

EYE CONTACT - In case of eye contact, flush the eyes with water for fifteen (15) minutes. If contact lenses are worn, quickly remove them, then flush the eyes with water. Have a physician examine the eyes.

SKIN CONTACT - In case of skin contact, remove contaminated clothing. Flush the skin with large amounts of water, then wash the skin with soap and water.

INGESTION - If material is ingested, seek immediate medical attention. If vomiting occurs spontaneously, keep the head below the hips to prevent aspiration of liquid into the lungs.

Notes to Physician: No data found

Section 5 - Fire Fighting Measures

SDS for: H4-1109 Page 2 of 7

Flash Point: 11 C (52 F)

LEL: 1.00 UEL: 11.00

EXTINGUISHING MEDIA: Use carbon dioxide (CO2), "alcohol" foam, dry chemical systems. Direct water application may cause violent frothing.

UNUSUAL FIRE OR EXPLOSION HAZARDS: The product may contain linseed oil and represents a spontaneoush combustion hazard. To avoid spontaneous combustion soak soiled rags and waste in water immediately after use in a closed metal containor.

HAZARDOUS COMBUSTION PRODUCTS: Oxides of carbon and hydrocarbons

FIRE FIGHTING: If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure. Use water spray to cool unopened containors. **FIRE FIGHTING:** If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

Section 6 - Accidental Release Measures

SPILL AND LEAK PROCEDURES: Spill supervisor - Ensure cleanup personnel wear all appropriate Personal Protective Equipment (PPE), including respiratory protection. Remove all ignition sources. Keep nonessential personnel away from the contaminated area.

SMALL SPILLS: Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant materials with water to prevent spontaneous combustion with alkyd type formulas.

Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

LARGE SPILLS: Prevent this material from entering sewers and watercourses by diking or impounding the spilled material. Advise authorities if the product has entered or may enter, sewers, watercourses, or extensive land areas .

Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant with water for alkyd type spills.

Section 7 - Handling and Storage

HANDLING PRECAUTIONS: Wear all appropriate Personal Protective Equipment (PPE). Wear respiratory protection or ensure adequate ventilation at all times as vapors can accumulate in confined or poorly ventilated areas. Use the product in a manner which minimizes splashes and/or the creation of dust. Keep containers closed when not in use. Do not handle or store material near heat, sparks, open flames, or other sources of ignition. Store at room temperatures, i.e., 40 to 95 F (4 to 35 C).

STORAGE: Prevent from freezing. Do not store above 120 F (49 C).

Store only in original containers.

REGULATORY REQUIREMENTS: No data found.

Section 8 - Exposure Controls / Personal Protection				
Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits	
ISOPROPANOL 67-63-0	400 ppm TWA; 980 mg/m3 TWA	400 ppm STEL 200 ppm TWA	NIOSH: 400 ppm TWA; 980 mg/m3 TWA 500 ppm STEL; 1225 mg/m3 STEL	

SDS for: H4-1109 Page 3 of 7

Printed: 10/18/2016 at 8:29:56AM

ISOBUTANOL 78-83-1	100 ppm TWA; 300 mg/m3 TWA	50 ppm TWA	NIOSH: 50 ppm TWA; 150 mg/m3 TWA
Zinc chromate 13530-65-9	Not Established	0.01 mg/m3 TWA (as Cr)	NIOSH: 0.0002 mg/m3 TWA (as Cr)
Zinc hydroxide 20427-58-1	Not Established	Not Established	Not Established
Talc (hydrous magnesium silicate) 14807-96-6	Not Established	2 mg/m3 TWA (particulate matter containing no asbestos and <1% crystalline silica, respirable fraction)	NIOSH: 2 mg/m3 TWA (containing no Asbestos and <1% Quartz, respirable dust)

ENGINEERING: Ensure processing (curing) ovens are properly vented to prevent the introduction of processing fumes into the workplace. Use explosion-proof equipment and good manufacturing practice.

VENTILATION: Use only with adequate ventilation, i.e., ventilation in compliance with occupational exposure limits.

ADMINISTRATIVE CONTROLS: No data found.

PROTECTIVE EQUIPMENT: Wear splash goggles. If extra protection is required, wear a face shield over the splash goggles. Face shields are effective only if worn in addition to splash goggles.

Wear a chemical-resistant, butyl-rubber apron and other protective clothing, as deemed appropriate, to avoid skin contact with material.

Wear chemical-resistant gloves (butyl rubber or neoprene). Protective gloves should be inspected frequently and discarded when they exhibit cuts, tears, pinholes, or signs of excessive wear.

CONTAMINATED EQUIPMENT: Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

Section 9 - Physical and Chemical Properties

This mixture typically exhibits the following properties under normal circumstances:

Viscosity: N/A	Coating VOC Lb/Gal 6.01
Appearance: N/A	Odor: N/A
Vapor Pressure: 25.3 mmHg	Odor threshold: N/A
Vapor Density: 2.2	pH: N/A
DENSITY 7.51	Melting point: N/A
Freezing point: N/A	Solubility: N/A
Boiling range: 83°C	Flash point: 52 F,11 C
Evaporation rate: N/A	Flammability: N/A
Explosive Limits: N/A	Partition coefficient (n- N/A octanol/water):
Autoignition temperature: N/A	Decomposition temperature: N/A

Section 10 - Stability and Reactivity

Stability:

STABLE

Components of this mixture are incompatible with the following materials:

This mixture is likely to exhibit the following combustion products:

Hazardous polymerization will not occur.

SDS for: H4-1109 Page 4 of 7 Printed: 10/18/2016 at 8:29:56AM

Section 11 - Toxicological Information

Mixture Toxicity

Oral Toxicity LD50: 2,552mg/kg Dermal Toxicity LD50: 4,946mg/kg Inhalation Toxicity LC50: 53mg/L

Routes of Entry:

Ingestion

Exposure to this material may affect the following organs:

Eyes Central Nervous System Skin Cardiovascular System Respiratory System

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

<u>CAS Number</u> <u>Description</u> <u>% Weight</u> <u>Carcinogen Rating</u>

13530-65-9 Zinc chromate 5 to 10% Zinc chromate: NIOSH: potential

occupational carcinogen (listed under Chromic acid and

chromates)

IARC: Human carcinogen

OSHA: listed

Section 12 - Ecological Information

Ecological information: No data found.

Component Ecotoxicity

ISOPROPANOL 96 Hr LC50 Pimephales promelas: 9640 mg/L [flow-through]; 96 Hr LC50

Pimephales promelas: 11130 mg/L [static]; 96 Hr LC50 Lepomis macrochirus:

>1400000 µg/L

48 Hr EC50 Daphnia magna: 13299 mg/L

96 Hr EC50 Desmodesmus subspicatus: >1000 mg/L; 72 Hr EC50

Desmodesmus subspicatus: >1000 mg/L

ISOBUTANOL 96 Hr LC50 Pimephales promelas: 1370 - 1670 mg/L [flow-through]; 96 Hr LC50

Pimephales promelas: 375 mg/L [static] (fry); 96 Hr LC50 Lepomis macrochirus: 1480 - 1730 mg/L [flow-through]; 96 Hr LC50 Oncorhynchus mykiss: 1120 -

1520 mg/L [flow-through]

48 Hr EC50 Daphnia magna: 1300 mg/L; 48 Hr EC50 Daphnia magna: 1070 -

1933 mg/L [Static]

Zinc chromate 96 Hr LC50 Oncorhynchus mykiss: 0.24 mg/L [static]; 96 Hr LC50 Poecilia

reticulata: 0.56 mg/L

Talc (hydrous magnesium silicate) 96 Hr LC50 Brachydanio rerio: >100 g/L [semi-static]

Section 13 - Disposal Considerations

As the US EPA, state, regional, and other regulatory agencies may have jurisdiction over the disposal of your facility's hazardous waste, it is incumbent upon you, the hazardous waste generator, to learn of and satisfy all the requirements which affect you. Dispose of the hazardous waste at a properly licensed and permitted disposal site or facility. Ensure conformity to all applicable hazardous waste disposal regulations.

The US EPA Hazardous Waste Numbers which follow are applicable to this unadulterated product if the product enters the "waste stream." Refer to Title 40 of the Code of Federal Regulations, Part 261 (40 CFR 261). This part of the Code identifies solid wastes which are subject to regulation under various sections of the Code and which are subject to the notification requirements of Section 3010 of the Resource Conservation and Recovery Act (RCRA).

SDS for: H4-1109 Page 5 of 7

Section 14 - Transport Information

Section 14 - Transport Information

<u>Agency</u>	Proper Shipping Name	UN Number	Packing Group	Hazard Class
DOT	PAINT	1263	II	3
IATA	PAINT	1263	II	3

15: Regulatory Information

MASSACHUSETTS RIGHT TO KNOW

14807-96-6 Talc (hydrous magnesium silicate) 1 to 5 % 13530-65-9 Zinc chromate 5 to 10 % 78-83-1 ISOBUTANOL 20 to 30 % 67-63-0 ISOPROPANOL 50 to 60 %

NEW JERSEY RIGHT TO KNOW

14807-96-6 Talc (hydrous magnesium silicate) 1 to 5 %13530-65-9 Zinc chromate 5 to 10 % 78-83-1 ISOBUTANOL 20 to 30 % 67-63-0 ISOPROPANOL 50 to 60 %

PENNSYLVANIA RIGHT TO KNOW

14807-96-6 Talc (hydrous magnesium silicate) 1 to 5 % 13530-65-9 Zinc chromate 5 to 10 % 78-83-1 ISOBUTANOL 20 to 30 % 67-63-0 ISOPROPANOL 50 to 60 %

CHEMICAL LIST FOR SARA 311/312

78-83-1 ISOBUTANOL

All Components Listed Country Regulation

EU Risk Phrases

Safety Phrase

- None

16: OTHER INFORMATION

Hazardous Material Information System (HMIS)




HMIS & NFPA Hazard Rating

* = Chronic Health Hazard

0 = INSIGNIFICANT

National Fire Protection Association (NFPA)

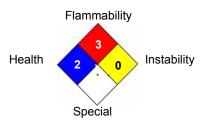

SDS for: H4-1109 Page 6 of 7 Date Prepared: 10/18/2016

SDS for: H4-1109 Page 7 of 7

SAFETY DATA SHEET

SECTION 1- MANUFACTURER'S IDENTIFICATION

Product Name: VINYL WASH PRIMER ACID COMPONANT

Manufacturer's Name: Induron Protective Coatings, LLC Address: 3333 Richard Arrington Blvd. N.

Birmingham, Alabama 35234

Product Code: Q4-1109

Emergency Phone: 1-800-424-9300 Information Phone: (205)324-9584

Section 2 - Composition / Information on Ingredients

	_	_		
α		\Box	tin	as:
υп		Na		us.

Flammable liquid	2	Flash point < 23°C and initial boiling point > 35°C (95°F)
Skin corrosive	1A	Destruction of dermal tissue: Exposure < 3 min. Observation
		< 1 hour, visible necrosis in at least one animal
Eye corrosive	1	Serious eye damage: Irreversible damage 21 days after
		exposure, Draize score: Corneal opacity >= 3, Iritis > 1.5
Reproductive toxin	2	Human or animal evidence possibly with other information

GHS Hazards

H225	Highly flammable
H314	Causes severe skin burns and eye damage
H318	Causes serious eye damage
H361	Suspected of damaging fertility or the unborn child

GHS

Pr	ecautions	
	P201	Obtain special instructions before use
	P202	Do not handle until all safety precautions have been read and understood
	P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking.
	P233	Keep container tightly closed.
	P240	Ground/bond container and receiving equipment.
	P241	Use explosion-proof electrical equipment.
	P242	Use only non-sparking tools.
	P243	Take precautionary measures against static discharge.
	P260	Do not breathe dust/fume/gas/mist/vapours/spray.
	P264	Wash equipment and contaminated skin thoroughly after handling.
	P280	Wear protective gloves/protective clothing/eye protection/face protection.
	P281	Use personal protective equipment as required
	P310	Immediately call a POISON CENTER or doctor/physician
	P321	Wash contaminated skin, follow Physcian's instructions for treatment.
	P363	Wash contaminated clothing before reuse
	P301+P330+P331	IF SWALLOWED: Rinse mouth. Do NOT induce vomiting
	P303+P361+P353	IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower
	P304+P340	IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable
	1 304 11 340	for breathing
	P305+P351+P338	IF IN EYES: Rinse continuously with water for several minutes. Remove contact
		lenses if present and easy to do – continue rinsing
	P308+P313	IF exposed or concerned: Get medical advice/attention
	P370+P378	In case of fire: Use CO2, water spray, foam, or dry chemical to extinguish.
	P405	Store locked up
	P403+P235	Store in a well ventilated place. Keep cool
	P501	Dispose of contents/container in accordance to approriate regulations and laws.

SDS for: Q4-1109 Page 1 of 6

Signal Word: Danger



Preexisting skin, eye, and respiratory disorders may be aggravated by exposure to this product. Impaired kidney and liver functions from preexisting disorders may be aggravated by exposure to this product.

Kidney damage may be evidenced by changes in urine output, urine appearance, or edema (swelling from fluid retention). Liver damage may be evidenced by loss of appetite, jaundice and sometimes pain in the upper abdomen on the right side.

Section 3 - Hazards Identification					
Chemical Name	CAS number	Weight Concentration %			
ISOPROPANOL	67-63-0	60.00% - 70.00%			
Phosphoric acid	7664-38-2	10.00% - 20.00%			

Section 4 - First Aid Measures

INHALATION - If product solids are inhaled either as dust or in the form of a spray mist, remove the person from exposure immediately. If breathing is difficult, irregular, or has stopped, start resuscitation; call a physician . Administer oxygen if a qualified operator is available.

EYE CONTACT - In case of eye contact, flush the eyes with water for fifteen (15) minutes. If contact lenses are worn, quickly remove them, then flush the eyes with water. Have a physician examine the eyes.

SKIN CONTACT - In case of skin contact, remove contaminated clothing. Flush the skin with large amounts of water, then wash the skin with soap and water.

INGESTION - If material is ingested, seek immediate medical attention. If vomiting occurs spontaneously, keep the head below the hips to prevent aspiration of liquid into the lungs.

Notes to Physician: No data found

Section 5 - Fire Fighting Measures

Flash Point: 12 C (53 F)

LEL: 3.00 UEL:

Combustible Product

EXTINGUISHING MEDIA: Use carbon dioxide (CO2), "alcohol" foam, dry chemical systems. Direct water application may cause violent frothing.

UNUSUAL FIRE OR EXPLOSION HAZARDS: The product may contain linseed oil and represents a spontaneoush combustion hazard. To avoid spontaneous combustion soak soiled rags and waste in water immediately after use in a closed metal containor.

HAZARDOUS COMBUSTION PRODUCTS: Oxides of carbon and hydrocarbons

FIRE FIGHTING: If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure. Use water spray to cool unopened containors. **FIRE FIGHTING:** If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

Section 6 - Accidental Release Measures

SPILL AND LEAK PROCEDURES: Spill supervisor - Ensure cleanup personnel wear all appropriate Personal

SDS for: Q4-1109 Page 2 of 6

Protective Equipment (PPE), including respiratory protection. Remove all ignition sources. Keep nonessential personnel away from the contaminated area.

SMALL SPILLS: Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant materials with water to prevent spontaneous combustion with alkyd type formulas.

Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

LARGE SPILLS: Prevent this material from entering sewers and watercourses by diking or impounding the spilled material. Advise authorities if the product has entered or may enter, sewers, watercourses, or extensive land areas.

Ventilate the contaminated area. Using nonsparking tools, mix the appropriate sorbent into the spilled material. Use an absorbent like sawdust for aqueous, waterborne, and solvent-borne coatings.

Collect the saturated sorbent and transfer it into a covered container. Steel containers are acceptable for all wastes except wastes which contain acid. Use suitable plastic containers for acid-bearing wastes. Wet absorbant with water for alkyd type spills.

Section 7 - Handling and Storage

HANDLING PRECAUTIONS: Wear all appropriate Personal Protective Equipment (PPE). Wear respiratory protection or ensure adequate ventilation at all times as vapors can accumulate in confined or poorly ventilated areas. Use the product in a manner which minimizes splashes and/or the creation of dust. Keep containers closed when not in use. Do not handle or store material near heat, sparks, open flames, or other sources of ignition. Store at room temperatures, i.e., 40 to 95 F (4 to 35 C).

STORAGE: Prevent from freezing. Do not store above 120 F (49 C).

Store only in original containers.

REGULATORY REQUIREMENTS: No data found.

Section 8 - Exposure Controls / Personal Protection							
Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits				
ISOPROPANOL 67-63-0	400 ppm TWA; 980 mg/m3 TWA	400 ppm STEL 200 ppm TWA	NIOSH: 400 ppm TWA; 980 mg/m3 TWA 500 ppm STEL; 1225 mg/m3 STEL				
Phosphoric acid 7664-38-2	1 mg/m3 TWA	3 mg/m3 STEL 1 mg/m3 TWA	NIOSH: 1 mg/m3 TWA 3 mg/m3 STEL				

ENGINEERING: Ensure processing (curing) ovens are properly vented to prevent the introduction of processing fumes into the workplace. Use explosion-proof equipment and good manufacturing practice.

VENTILATION: Use only with adequate ventilation, i.e., ventilation in compliance with occupational exposure limits.

ADMINISTRATIVE CONTROLS: No data found.

PROTECTIVE EQUIPMENT: Wear splash goggles. If extra protection is required, wear a face shield over the splash goggles. Face shields are effective only if worn in addition to splash goggles.

Wear a chemical-resistant, butyl-rubber apron and other protective clothing, as deemed appropriate, to avoid skin contact with material.

Wear chemical-resistant gloves (butyl rubber or neoprene). Protective gloves should be inspected frequently and discarded when they exhibit cuts, tears, pinholes, or signs of excessive wear.

CONTAMINATED EQUIPMENT: Dispose of the waste in compliance with all Federal, state, regional, and local regulations.

SDS for: Q4-1109 Page 3 of 6

Section 9 - Physical and Chemical Properties

This mixture typically exhibits the following properties under normal circumstances:

Viscosity: N/A Coating VOC Lb/Gal 5.91

Appearance: N/A

Vapor Pressure: 28.1 mmHg

Vapor Density: 2.1

DENSITY 7.68

Freezing point: N/A

Boiling range: 83°C

Evaporation rate: N/A

Explosive Limits: N/A

Autoignition temperature: N/A

Odor: N/A

Odor threshold: N/A

pH: N/A

Melting point: N/A

Solubility: N/A

Flash point: 53 F,12 C

Flammability: N/A

Partition coefficient (n- N/A

octanol/water):

Decomposition temperature: N/A

Section 10 - Stability and Reactivity

Stability:

STABLE

Components of this mixture are incompatible with the following materials:

This mixture is likely to exhibit the following combustion products:

Hazardous polymerization will not occur.

Section 11 - Toxicological Information

Mixture Toxicity

Oral Toxicity LD50: 2,217mg/kg Dermal Toxicity LD50: 4,585mg/kg Inhalation Toxicity LC50: 112mg/L

Routes of Entry:

Ingestion

Exposure to this material may affect the following organs:

Eyes Skin **Respiratory System**

Effects of Overexposure

Carcinogenicity: The following chemicals comprise 0.1% or more of this mixture and are listed and/or classified as carcinogens or potential carcinogens by NTP, IARC, OSHA (mandatory listing), or ACGIH (optional listing).

Description % Weight **CAS Number** Carcinogen Rating

Section 12 - Ecological Information

Ecological information: No data found.

Component Ecotoxicity

ISOPROPANOL 96 Hr LC50 Pimephales promelas: 9640 mg/L [flow-through]; 96 Hr LC50

Pimephales promelas: 11130 mg/L [static]; 96 Hr LC50 Lepomis macrochirus:

>1400000 µg/L

48 Hr EC50 Daphnia magna: 13299 mg/L

96 Hr EC50 Desmodesmus subspicatus: >1000 mg/L; 72 Hr EC50

Desmodesmus subspicatus: >1000 mg/L

SDS for: Q4-1109 Page 4 of 6

Section 13 - Disposal Considerations

As the US EPA, state, regional, and other regulatory agencies may have jurisdiction over the disposal of your facility's hazardous waste, it is incumbent upon you, the hazardous waste generator, to learn of and satisfy all the requirements which affect you. Dispose of the hazardous waste at a properly licensed and permitted disposal site or facility. Ensure conformity to all applicable hazardous waste disposal regulations.

The US EPA Hazardous Waste Numbers which follow are applicable to this unadulterated product if the product enters the "waste stream." Refer to Title 40 of the Code of Federal Regulations, Part 261 (40 CFR 261). This part of the Code identifies solid wastes which are subject to regulation under various sections of the Code and which are subject to the notification requirements of Section 3010 of the Resource Conservation and Recovery Act (RCRA).

Section 14 - Transport Information

Section 14 - Transport Information

Agency	Proper Shipping Name	UN Number	Packing Group	Hazard Class
DOT	PAINT	1263	II	3
IATA	PAINT	1263	II	3

15: Regulatory Information

MASSACHUSETTS RIGHT TO KNOW 7664-38-2 Phosphoric acid 10 to 20 % 67-63-0 ISOPROPANOL 60 to 70 %

NEW JERSEY RIGHT TO KNOW 7664-38-2 Phosphoric acid 10 to 20 % 67-63-0 ISOPROPANOL 60 to 70 %

PENNSYLVANIA RIGHT TO KNOW 7664-38-2 Phosphoric acid 10 to 20 % 67-63-0 ISOPROPANOL 60 to 70 %

Country Regulation All Components Listed

EU Risk Phrases

Safety Phrase

- None


16: OTHER INFORMATION

Hazardous Material Information System (HMIS)

National Fire Protection Association (NFPA)

SDS for: Q4-1109 Page 5 of 6



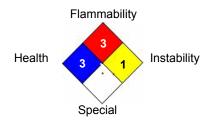

Reviewer Revision

Date Prepared: 10/18/2016

SDS for: Q4-1109 Page 6 of 6